



Dart Aerospace Ltd.
1270 Aberdeen St
Hawkesbury, ON
K6A 1K7
Canada

Tel (613) 632-5200

2

D119-796-141TRN
Job Sheet 180271



Part No: D119-796-141TRN

Job Qty: 1 ea

Part Name: Crosstube Turning Detail



Part Weight: 0 lbs

Status: Scheduled

Priority: Medium

Job Created: 7/4/18

Job Tracking No:

Due Date: 7/31/18

Created By: Marie Lajeunesse

Type: SOLD

Description:

Note: D119-796-141 REV H IPP REV A RQ 14/06/06 VERIFIED BY DD IPP REV:B 16.05.04 AS PER DWG REV.H
DD VERF:JLM

Ship Via:

Bill of Materials

Job Routing

Op No	Operation	Qty	Start Date	Due Date	Standard		Workcenter/Supplier		Sign-off
					Setup hrs	Run Hrs	Workcenter / Supplier	Lead Time	
90	Start up Operation	1 Ea	7/31/18	7/31/18	0.00	0.00	Start Up Crosstubes-1		MD
100	Mori Seiki	1 pcs	7/31/18	7/31/18	1.99	1.52	Mori Seiki TL-40		MD
110	QC	1 pcs	7/31/18	7/31/18	0.00	0.00	QC2		MD
120	Mori Seiki	1 pcs	7/31/18	7/31/18	0.00	1.52	Mori Seiki TL-40		MD
130	QC	1 pcs	7/31/18	7/31/18	0.00	0.00	QC2		MD
140	QC	1 pcs	7/31/18	7/31/18	0.00	0.00	QC8		MD
145	Crosstubes	1 pcs	7/31/18	7/31/18	0.00	0.33	Crosstubes-1		MD
150	HandFXtube	1 pcs	7/31/18	7/31/18	0.00	0.40	Crosstubes-3		MD
160	QC	1 pcs	7/31/18	7/31/18	0.00	0.00	QC7-1		MD
170	Packaging	1 pcs	7/31/18	7/31/18	0.00	0.00	Packaging3-1		MD
180	QC21-FG	1 Ea	7/31/18	7/31/18	0.00	0.00	QC21		MD

Part Op 100 - 1-Fill tube with sand & install plugs on both ends as per Folio FB316 2-Turn first side as per Folio FB316 3-Blend
Descriptions: transition lines only, **do not sand whole tube**: FOLIO REV: H DWG REV: H *Use mill bastard
file, brush file repeatedly with file card. *Do not use sandpaper coarser than 320 grit.

120 - 1-Turn second side as per Folio FB316 2-Blend transition lines only, **do not sand whole tube**: 3-Remove sand
and plugs 4- scribe batch # and part # as per dwg

145 - GRIND ONLY TRANSITION LINES SMOOTH LONGITUDE WAY.

150 - 1- handfinish X-TUBE INSIDE AND OUT 2- ALODINE AND ACID ETCH X-TUBE INSIDE AND OUT. USE RED
SCOTCH BRITE

170 - LOCATION : LG014

Job BOM

Part / Item	Component Name	Quantity	Operation	Container
D6024-103	Crosstube Material	1 Ea (1 ea)	90-Start up Operation	

B150732

Job Allocations

Operation	Component Part	Required	Inventory	Allocated
90-Start up Operation	D6024-103	1	24	0

Part Specifications

Specifications could not be found.

DQA: _____ Date: _____

WORK ORDER NON-CONFORMANCE / UPDATE



QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION ☐ Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved
Date : _____	Step #: _____
Description Work Order Deviation	

Root Cause			FAULT CATEGORY					
Environment	☐	No Re-verification	☐	Pressure/Forced	☐	Power Loss/Surge	☐	Positioned Wrong
Design	☐	Operator	☐	Bending	☐	Folio/Program	☐	Outside Dimensions
Doc/Data	☐	Offset/Setup	☐	Centre Not Concentric	☐	Grain	☐	Over/Under tolerance
Equip/Tooling	☐	Supplier	☐	Cracks	☐	Weld	☐	Part Incorrect
Handling/Pre	☐	Training	☐	Crimp/Kink/Ripple/Wave	☐	Wrong Stock Pulled	☐	Part Lost/Missing
Material	☐	Use for Testing	☐	Cuffs	☐	Out of Sequence	☐	Part Moved
Internal Transport	☐	Poor Information	☐	Crushing	☐	Off-set	☐	Drawing
Tribal Knowledge	☐	Rushing	☐	Heat Treat	☐	Mislabeled	☐	Finish
LOA	☐	Product Improvement	☐	Wave/Twist in Tube	☐	Fit/Function	☐	Misread
Substation	☐	Process Improvement	☐	Marks/Chatter	☐	Misaligned/off center	☐	Turning Sequence
Past Expiry Date	☐	Manufacturing Process						
Misidentified	☐	Past Due						
			OTHER : _____					

DART AEROSPACE
 1270 Aberdeen Street
 Hamilton, ON K6A 1K7
 CANADA
 TEL: 1 813 632-8200
 Email: sales@dartaero.com
 www.dartaerospace.com
 Date: 09/20/18
 Container No: S112019
 Part: D119-796-1411RN
 Job No: 180271
 Serial No/Batch: S112019
 Revision: H
 Inspector:
 Exp Date:
 Instructions:

②

DART AEROSPACE LTD	Work Order: 180271
Description: Crosstube Assembly (AW119 MKII Fwd)	Part Number: D119-796-141TRN
Inspection Dwg: D119-796-141 Rev: H	Page 1 of 2

FIRST ARTICLE INSPECTION CHECKLIST

	Inspection Sheet Drawing Dimension	Tolerance	Actual Dimension	Accept	Reject	Method of Inspection	Comments
SIDE A	6.00	+/-0.030	5.985	✓		CNC-08	
	2.516	+/-0.005	2.518	✓		CNC-04	
	2.333	+0.005/-0.000	2.337	✓			
	2.333	+0.005/-0.000	2.338	✓			
	2.408	+0.005/-0.000	2.413	✓			
	2.502	+0.005/-0.000	2.507	✓			
	2.596	+0.005/-0.000	2.601	✓			
	2.596	+0.005/-0.000	2.601	✓			
SIDE B	6.00	+/-0.030	5.980	✓		CNC-08	
	2.516	+/-0.005	2.518	✓		CNC-04	
	2.333	+0.005/-0.000	2.338	✓			
	2.333	+0.005/-0.000	2.338	✓			
	2.408	+0.005/-0.000	2.413	✓			
	2.502	+0.005/-0.000	2.507	✓			
	2.596	+0.005/-0.000	2.601	✓			
	2.596	+0.005/-0.000	2.601	✓			
	102.26	+/-0.020	102.250	✓		Tape	

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____


Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval		
Description Work Order Deviation				Disposition					
Root Cause		FAULT CATEGORY							
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐				
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐				
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐				
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐				
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐				
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐				
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐				
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐				
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐				
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐				
Past Expiry Date ☐	Manufacturing Process ☐	OTHER : _____							
Misidentified ☐	Past Due ☐								

②

DART AEROSPACE LTD	Work Order: 180271
Description: Crosstube Assembly (AW119 MKII Fwd)	Part Number: D119-796-141TRN
Inspection Dwg: D119-796-141 Rev: H	Page 2 of 2

WALL THICKNESS MEASUREMENT

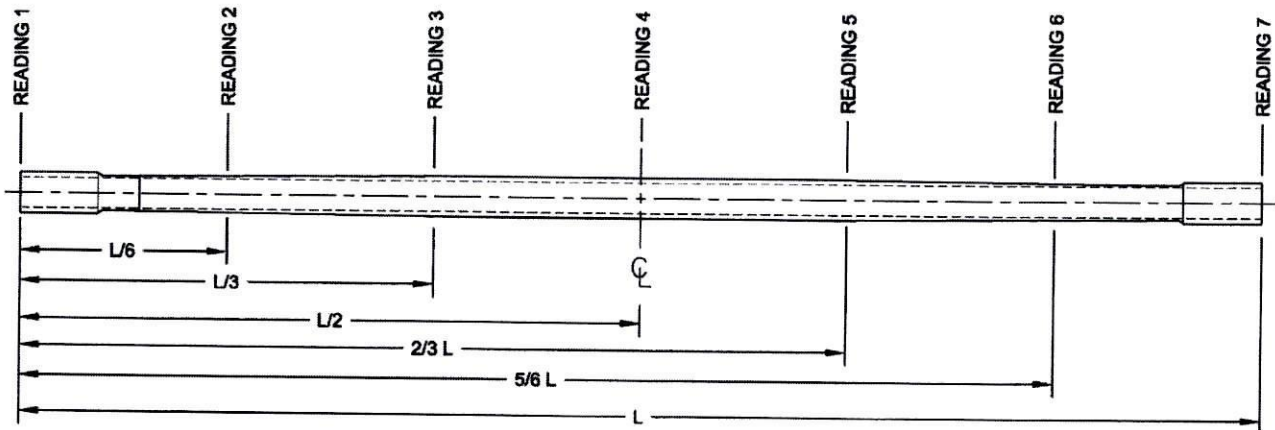

Location	WALL THICKNESS MEASUREMENT (IN)				Deviation Δw (max-min)	TOLERANCE
	w1	w2	w3	w4		
READING 1 L= 0"	.263	.255	.244	.249	.019	0.030"
READING 2 L= 17.043	.182	.164	.167	.184	.020	
READING 3 L= 34.087	.286	.251	.254	.284	.035	0.063"
READING 4 L= 51.130	.317	.311	.294	.297	.023	
READING 5 L= 68.173	.281	.278	.257	.259	.024	
READING 6 L= 85.217	.185	.182	.168	.168	.017	0.030"
READING 7 L= 102.26	.263	.272	.248	.244	.028	

Calibration Result

Actual Block Thickness: 100-300

Sitiescan 250 Measured Thickness: 100-300

Measured by: MD	Audited by: GD	Preliminary Approval:
Date: 2018-09-20	Date: 2018-09-20	Date:

Rev	Date	Change	Revised by	Approved
A	15.04.14	New Issue (P/O D119-796-101)	KJ	
B	15.05.14	Tolerances revised per Dwg Rev G	KJ	
C	16.05.27	Dwg Rev updated	KJ	
D	16.09.13	Tolerance revised for Reading 3, 6 & 7	KJ	

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE


QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval		
Description Work Order Deviation				Disposition					
Root Cause		FAULT CATEGORY							
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐				
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐				
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐				
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐				
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐				
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐				
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐				
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐				
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐				
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐				
Past Expiry Date ☐	Manufacturing Process ☐								
Misidentified ☐	Past Due ☐	OTHER :							

ITEM	QTY	P/N	DESCRIPTION
	X	D119-796-141	XTUBE ASSY (AW119 MKII FWD)
1	1	D119-796-141BND	CROSSTUBE, FWD
2	4	D2873-043	RADIUS BLOCK
3	4	D5123-3	CLAMP CUSHION
4	2	D5124-1	FWD SUPPORT
5	2	D5152-041	FWD POST MOUNT ASSY
6	2	D5305-1	SHIM
7	16	CR3212-4-08	RIVET, BLIND CSK
8	4	MS21920-24	CLAMP

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 180271 MJS
180704

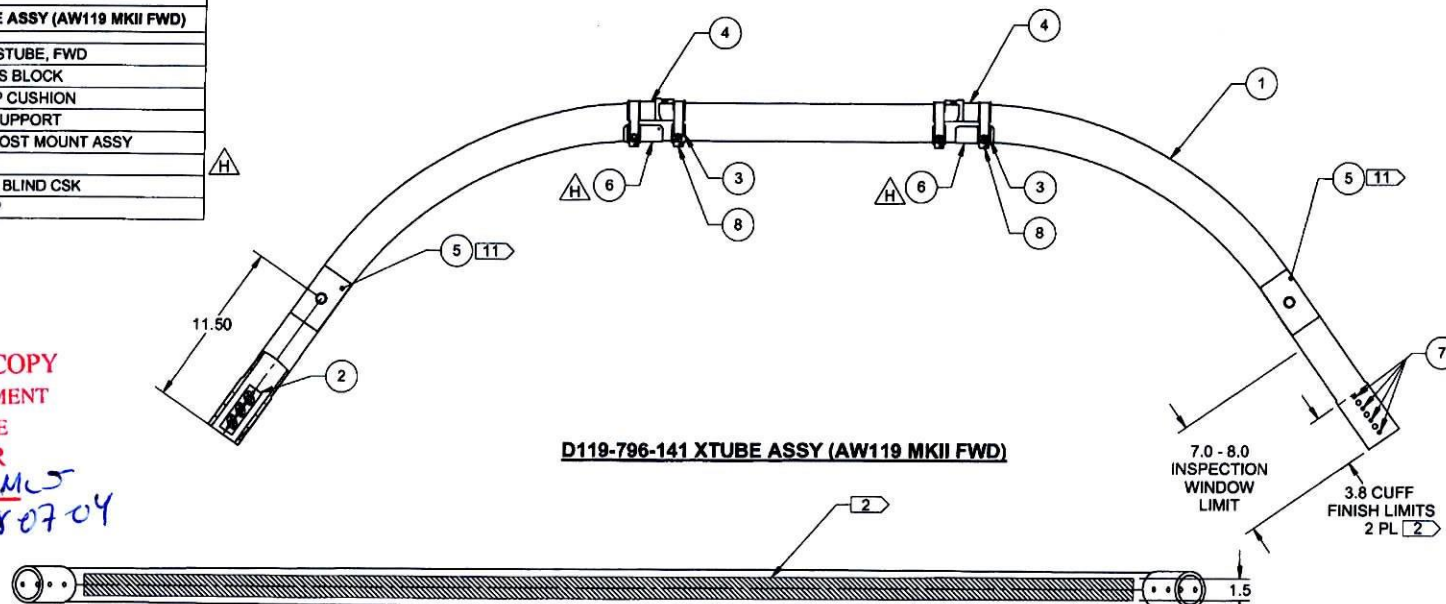

D119-796-141 XTUBE ASSY (AW119 MKII FWD)

NOTES:

- 1) MATERIAL: N/A
- 2) FINISH: APPLY MATTE CLEAR COAT PER QSI 005 4.2
MASK D5124-1 FWD SUPPORTS, D5305-1 SHIMS AS WELL AS UNDERSIDE OF CROSSTUBE AS SHOWN (B3-1, HATCHED AREA),
PAINT OUTSIDE PER DART QSI 005 4.2 AFTER APPLYING CLEAR COAT
DO NOT APPLY FINISH (PAINT OR CLEAR COAT) TO CUFFS IN LOCATION SHOWN, MASK PRIOR TO FINISHING
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) BREAK SHARP EDGES: N/A
- 6) IDENTIFICATION: IDENTIFY USING PART NUMBER "D119-796-141" AND BATCH NUMBER ON INSIDE OF CUFF PER QSI 044 6.4
- 7) WEIGHT: 18.54 lbs
- 8) EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE.
THE OUTSIDE SURFACE MUST BE SMOOTH AND FREE FROM DEFECTS SUCH AS SCRATCHES, NICKS OR DENTS.
DEFECTS UP TO 0.005 MAY BE BLENDED OUT LONGITUDINALLY. CIRCUMFERENTIAL GRIND MARKS ARE UNACCEPTABLE.
- 9) PRIOR TO FINISHING, ABRASE MATING SURFACES OF D5124-1 FWD SUPPORTS AND CROSSTUBE WITH SCOTCH BRITE 7447 RED AND REMOVE RESIDUE WITH DUPONT 4105S WASHN'WIPE DEGREASER. APPLY A 0.1 MIN THK LAYER OF PROSEAL 890 ON THE INSIDE CONCAVE SURFACE OF THE D5124-1 FWD SUPPORTS AND INSTALL AT AN 8.4° OFFSET FROM THE CROSSTUBE BENDING PLANE. INSTALL THE MS21920-24 CLAMPS AND D5123-3 CLAMP CUSHIONS WHILE WET.
- 10) TORQUE MS21920-24 CLAMPS 80 - 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY, THE NUT IS FACING AFT AND HAS NOT BOTTOMED-OUT AFTER TORQUING. PRIOR TO PACKAGING, RE-CHECK TORQUE ON CLAMPS AFTER PROSEAL 890 SEALANT HAS CURED FOR 72 HOURS.
- 11) PRIOR TO FINISHING, ABRASE MATING SURFACES OF CROSSTUBE AND D5152-041 WITH SCOTCH BRITE 7447 RED AND REMOVE RESIDUE WITH DUPONT 4105S WASHN'WIPE DEGREASER. INSTALL D5152-041 WITH LAYER OF PROSEAL 890 ON INSIDE CONCAVE SURFACE, 0.1 MIN THK. LOCATE D5152-041 USING TOOL DT10089.
- 12) PRIOR TO FINISHING, ABRASE MATING SURFACES OF CROSSTUBE AND D5305-1 SHIM WITH SCOTCH BRITE 7447 RED AND REMOVE RESIDUE WITH DUPONT 4105S WASHN'WIPE DEGREASER. INSTALL D5305-1 SHIM WITH LAYER OF PROSEAL 890 ON INSIDE CONCAVE SURFACE, 0.1 MIN THK. USE ADDITIONAL TEMPORARY MS21920-24 CLAMP TO APPLY CLAMPING PRESSURE FOR 72 HOURS.

RELEASED
2015-11-04
EW 15-142

H	ADD D5305-1 SHIM, D6024-103 WAS D6005-103, D5124-1 NOW INSTALLED ON PRIMER	AP	15.10.13
G	FINISHING ORDER ADJUSTED, CR3212-4-08 WAS -07, CUFF DIA TOLERANCE INCREASED TO +/- 0.005	AP	15.04.24
F	REMOVED PRIMER/ PAINT ON CUFFS, 2.516 WAS 2.500 (C6-5)	AP	15.02.03
E	D5152-041 FWD STEP POST ASSY WAS D5150-1 STEP POST. SCOTCH BRITE 7447 RED WAS 180 GRIT SANDPAPER, ANGLE (B7-2) DIMENSIONED FROM NEW DATUM	DB	15.01.15
D	ADD D5150-1 STEP POST (2X), MOVED INSPECTION WINDOW DETAIL TO SHEET 1, MODIFIED NOTES ON SHT 1 & 3	DB	14.11.25
C	CR3212-4-07 RIVETS WERE CR3212-4-09, 7.5 DEG CUFF ANGLE OFFSET REMOVED (SHT 3), CUFF DIAMETER ON D119-796-141 TRN REDUCED TO 2.500, ADDED INSPECTION WINDOW (B7-3), ADDED SHT 4	AP	14.10.23
B	ADDED D2873-043 RADIUS BLOCK, CR3212-4-09 RIVETS, ADDED SKIDTUBE REFERENCE FOR LOCATING CUFF HOLES, RE-ORGANIZED NOTES AND REMOVED REDUNDANT INFORMATION	AP	14.09.02
A	NEW ISSUE	AP	14.08.09
REV.	DESCRIPTION	BY	DATE
DESIGN	AP	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA DRAWING NO. D119-796-141 TITLE XTUBE ASSY (AW119 MKII FWD) COPYRIGHT © 2014 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL. IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	
DRAWN	AP		
CHECKED	AJS		
MFG. APPR.	JLM		
APPROVED	WM		
DE APPR.	DS	REV. H SHEET 1 OF 8 SCALE NTS	
DATE	15.10.13		

APPROVED

DQA: _____ Date: _____




WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval		
Description Work Order Deviation				Disposition					
Root Cause		FAULT CATEGORY							
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐				
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐				
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐				
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐				
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐				
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐				
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐				
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐				
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐				
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐				
Past Expiry Date ☐	Manufacturing Process ☐	OTHER :							
Misidentified ☐	Past Due ☐								

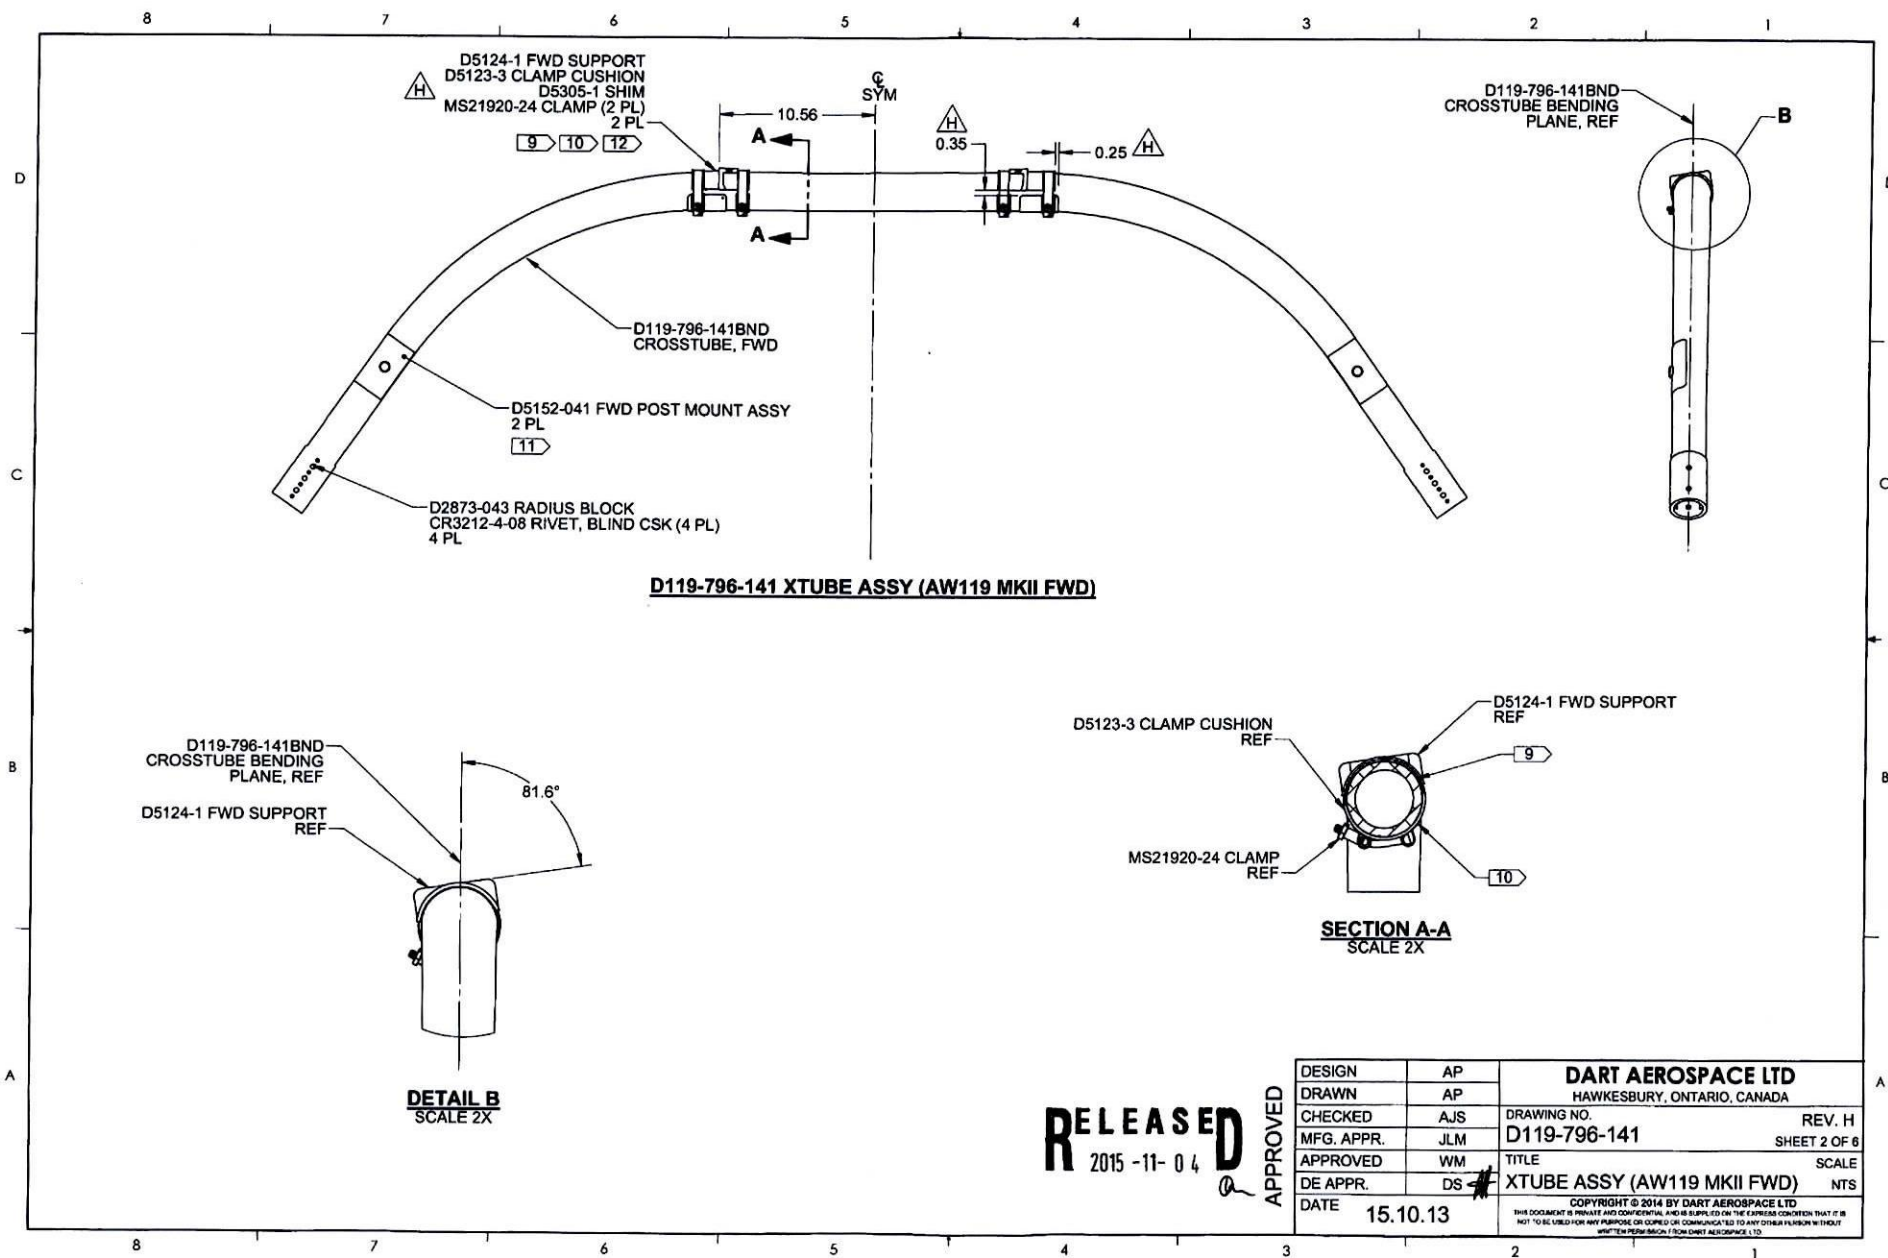

RELEASED
2015-11-04

APPROVED

DESIGN	AP	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWN	AP		
CHECKED	AJS	DRAWING NO.	REV. H
MFG. APPR.	JLM	D119-796-141	SHEET 2 OF 8
APPROVED	WM	TITLE	SCALE
DE APPR.	DS	XTUBE ASSY (AW119 MKII FWD)	NTS
DATE	15.10.13	COPYRIGHT © 2014 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL. IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

DQA: _____ Date: _____




WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval		
Description Work Order Deviation				Disposition					
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐		OTHER : _____					

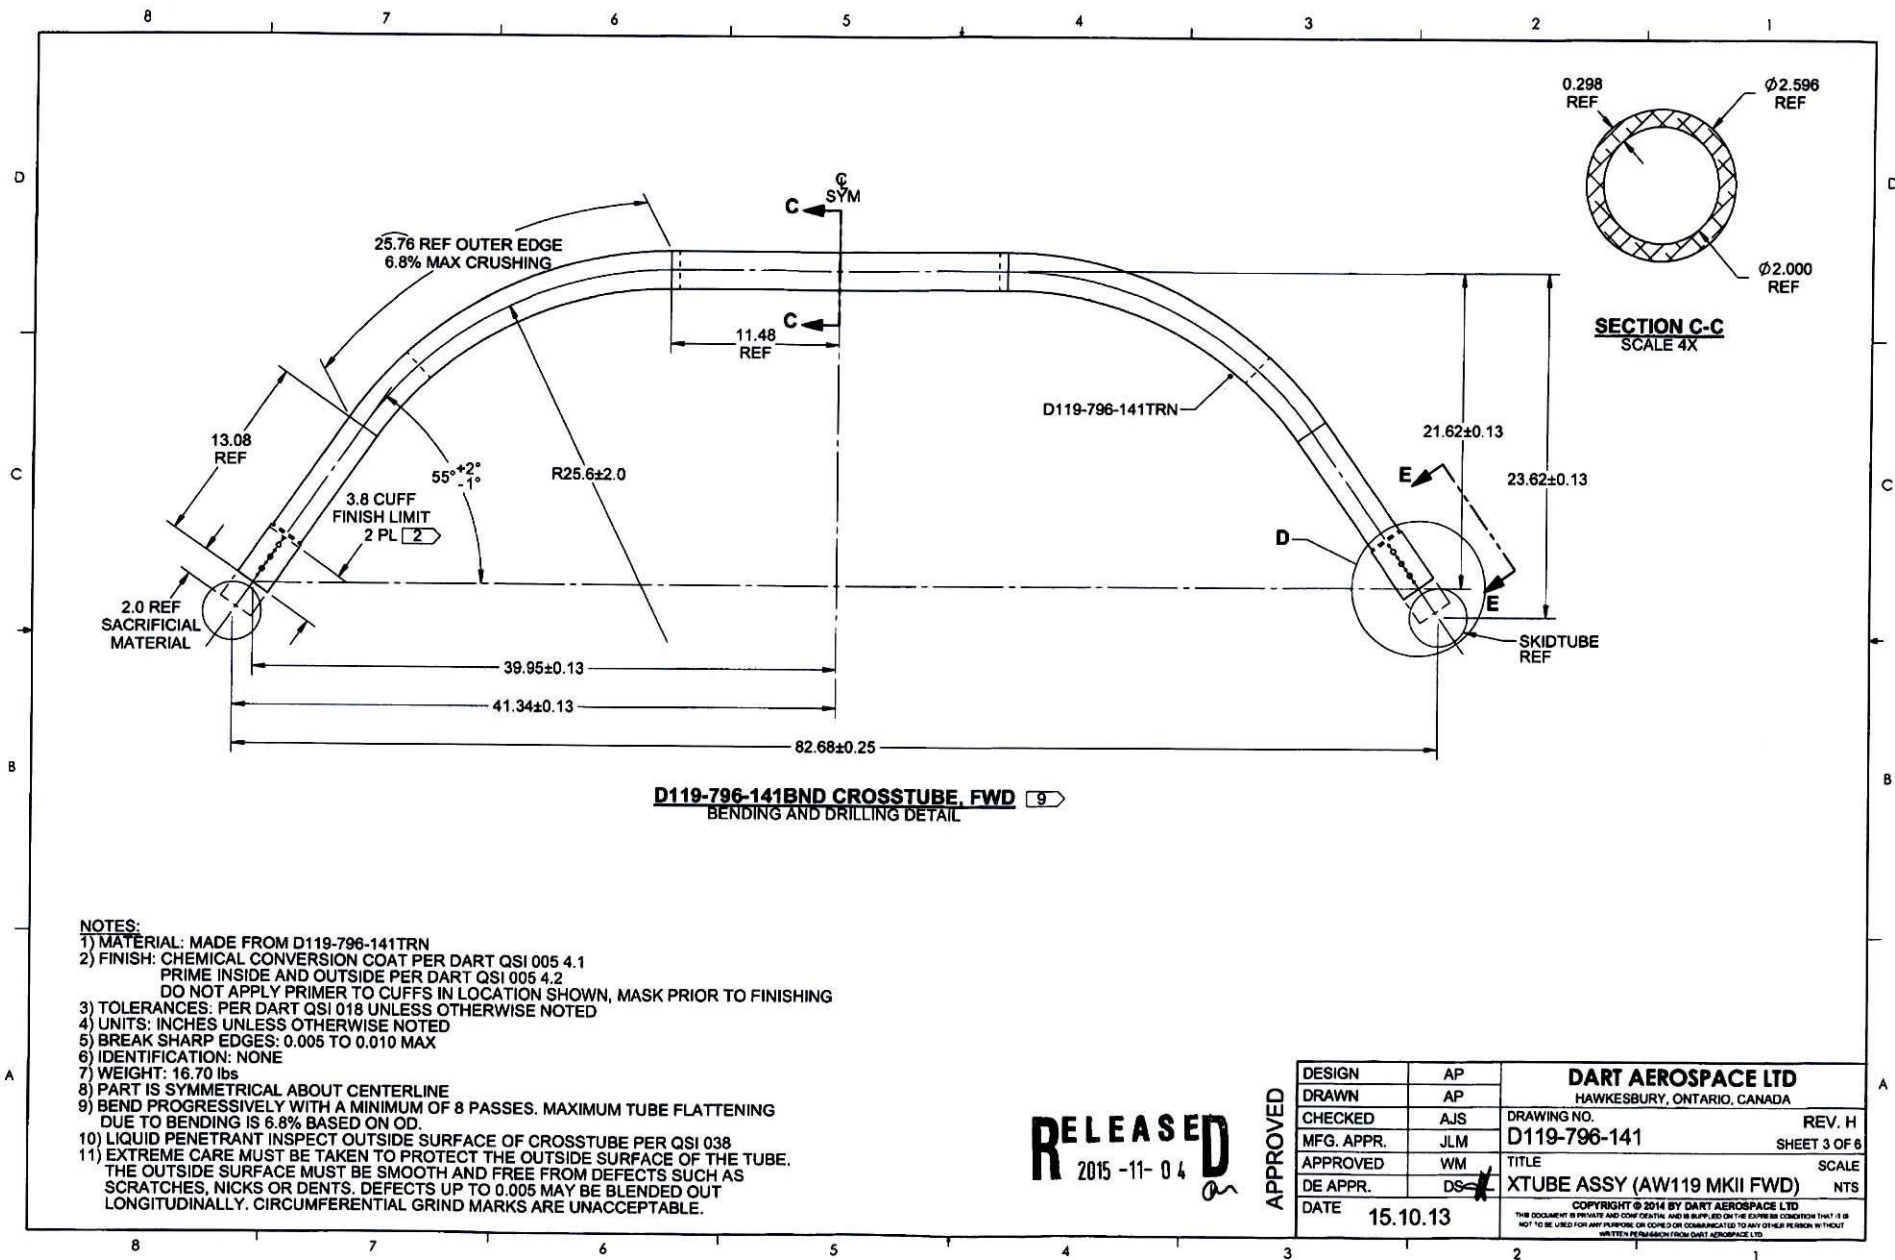

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date : _____	Step #: _____	QTY Effective : _____		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY			
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
OTHER : _____					



RELEASED
2015-11-04

APPROVED

DESIGN	AP	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA DRAWING NO. D119-796-141 TITLE XTUBE ASSY (AW119 MKII FWD) COPYRIGHT © 2014 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL. IT IS SUPPLIED ON THE CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	REV. H
DRAWN	AJS		SHEET 4 OF 6
CHECKED	AJS		SCALE
MFG. APPR.	JLM		NTS
APPROVED	WM		
DE APPR.	DS		
DATE	15.10.13		

DQA: _____ Date: _____




WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval		
Description Work Order Deviation				Disposition					
Root Cause		FAULT CATEGORY							
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐				
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐				
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐				
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐				
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐				
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐				
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐				
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐				
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐				
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐				
Past Expiry Date ☐	Manufacturing Process ☐	OTHER :							
Misidentified ☐	Past Due ☐								

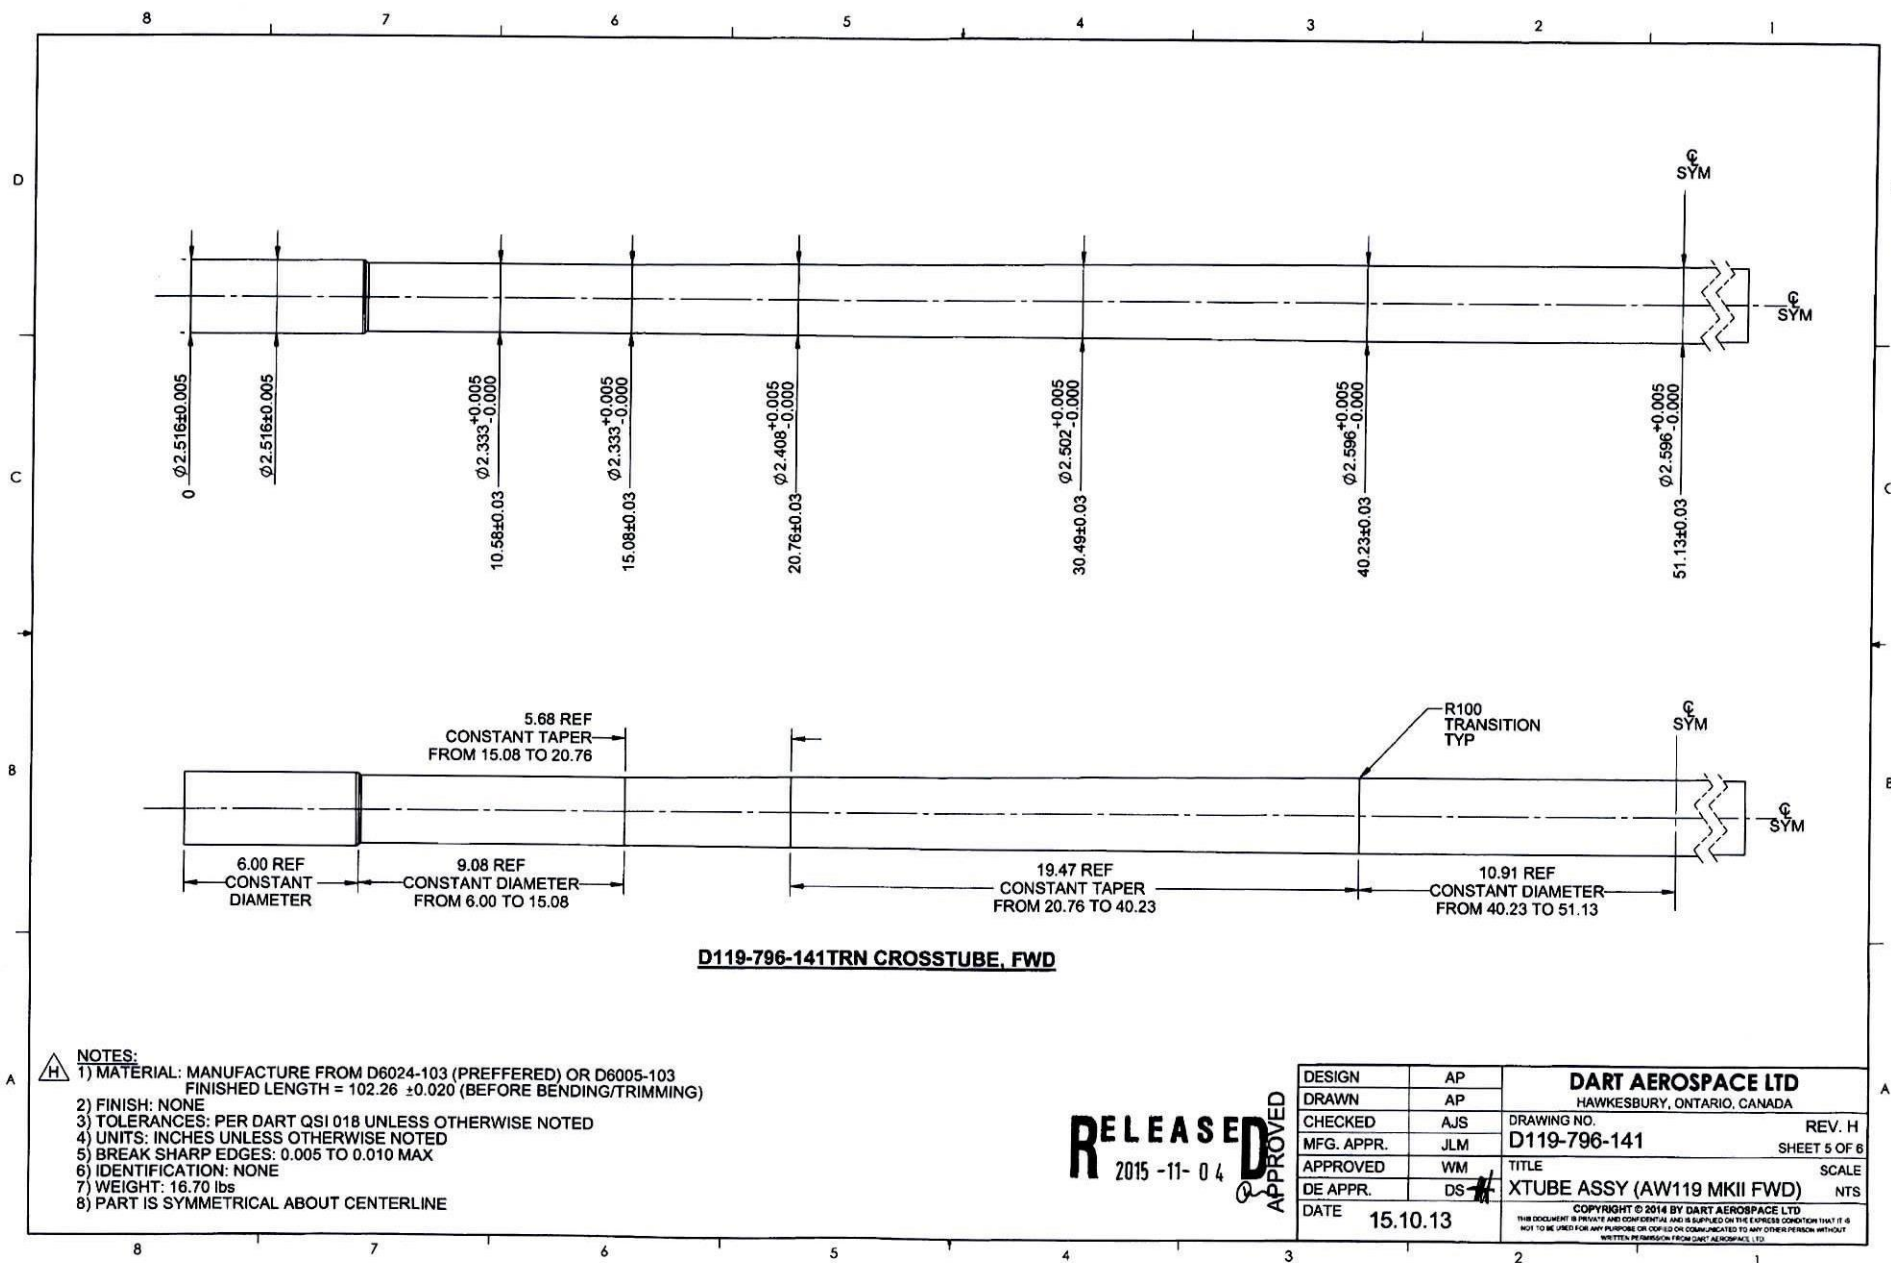

DQA: _____ Date: _____




WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY			
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
OTHER : ☐					

D119-796-141TRN CROSSTUBE, FWD
 SUPPLEMENTAL VIEW: NOMINAL WALL THICKNESS

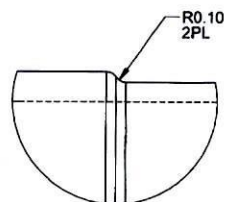

DETAIL F
 SCALE 2X

DESIGN	AP	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWN	AP		
CHECKED	AJS	DRAWING NO.	REV. H
MFG. APPR.	JLM	D119-796-141	SHEET 6 OF 6
APPROVED	WM	TITLE	SCALE
DE APPR.	DS	XTUBE ASSY (AW119 MKII FWD)	NTS
DATE	15.10.13	COPYRIGHT © 2014 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

RELEASED
 2015-11-04

APPROVED

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval		
Description Work Order Deviation				Disposition					

Root Cause				FAULT CATEGORY			
Environment ☐		No Re-verification ☐		Pressure/Forced ☐		Temperature/Cure ☐	
Design ☐		Operator ☐		Bending ☐		Set-up ☐	
Doc/Data ☐		Offset/Setup ☐		Centre Not Concentric ☐		BOM/Route ☐	
Equip/Tooling ☐		Supplier ☐		Cracks ☐		Broken/Damage/Defect ☐	
Handling/Pre ☐		Training ☐		Crimp/Kink/Ripple/Wave ☐		Inspection Incomplete/Unqualified ☐	
Material ☐		Use for Testing ☐		Cuffs ☐		Contamination ☐	
Internal Transport ☐		Poor Information ☐		Crushing ☐		Countersink ☐	
Tribal Knowledge ☐		Rushing ☐		Heat Treat ☐		Cut Too Short ☐	
LOA ☐		Product Improvement ☐		Wave/Twist in Tube ☐		Instructions Incomplete/Unclear ☐	
Substation ☐		Process Improvement ☐		Marks/Chatter ☐		Drill Holes ☐	
Past Expiry Date ☐		Manufacturing Process ☐		OTHER : _____			
Misidentified ☐		Past Due ☐					